


OFFICE OF THE MARION COUNTY SURVEYOR  
 SECTION RECORD CORNER  
 SECTION 19 TOWNSHIP 17 RANGE 5  
 DATE: 5-2-02  
 PARTY CHIEF: Wilcoxon  
 CREW: \_\_\_\_\_  
 TYPE OF MARKER: Harrison 8" down  
 METHOD OF ESTABLISHMENT: County: 2-22-95

IN. S.P.C. E ZONE NAD '83  
 NAME: 17051901  
 N: 517862.2729(m)  
 E: 70326.3356(M)

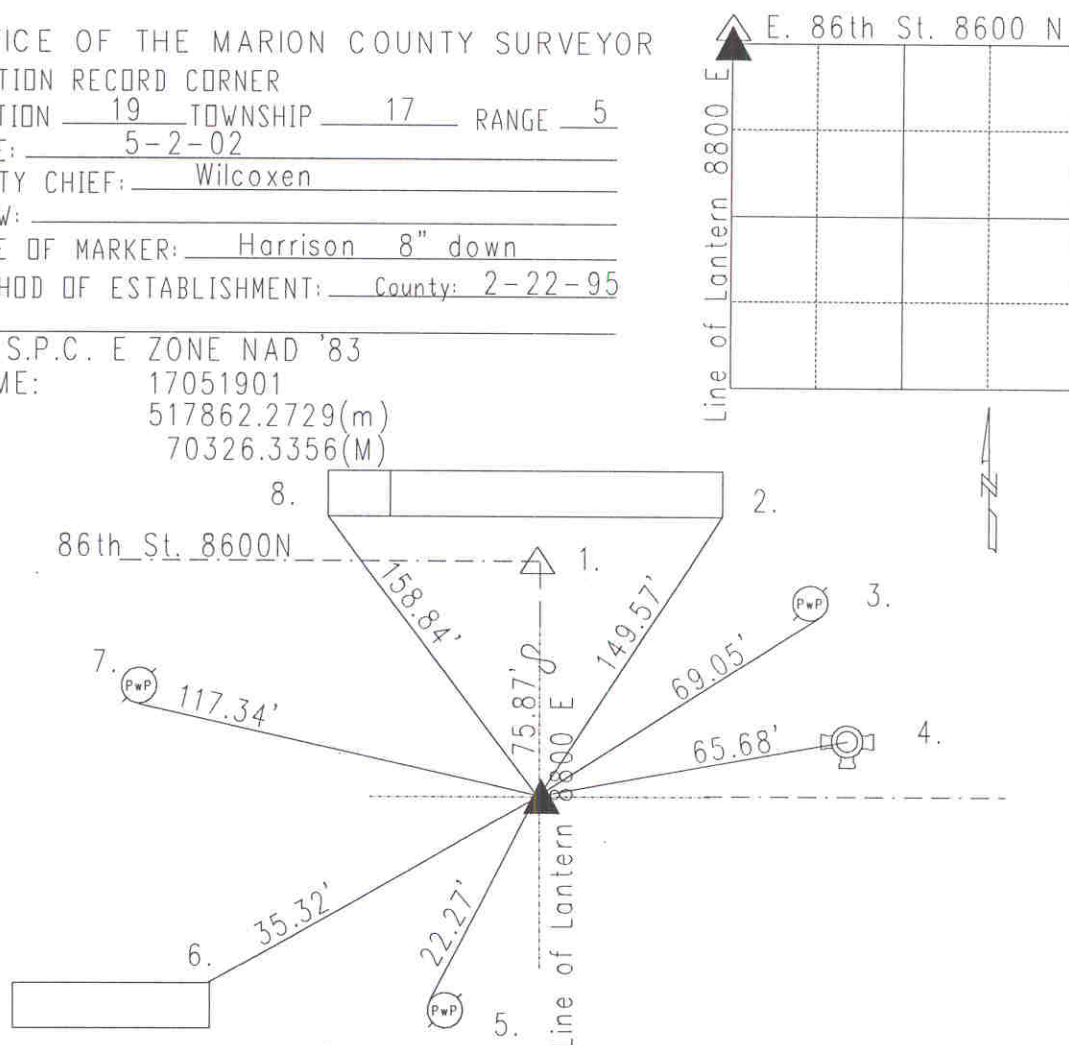

Original post set 1821 by Laughlin with witness: 12' hickory N 20 E 18 links; 20" ash N 44 W 20 links, falling was S of NE 24-17-4, 109 links or 71.94'. Legal by Wilson, 8-1854 per Lawrence Township Legal survey Book pg. 9. 'stone' No witness given. No falling given to NE 24-17-4. 3-24-76 Wilcoxon called iron pin. Falling is 75.72' S of NE 24-17-4. No reference to type of monument. 3-76 to the NW 19-17-5 refer to county ties 10-6-59; however, ties could not be located. 10-6-59 Monroe tied to NE 24-17-4 called iron pin 15" dn. No falling 9-20-79 Wilcoxon tied to NW 19-17-5 called same. Excavated 5-25-82 by Green. 5/8" steel rebar fd at surface, adjacent to 6' long steel angle. No stone recovered. Set Harrison. Re-tied 2-22-95 by Wilcoxon. Re-tied 5-2-02 by Wilcoxon  
 17051901

REF.	DISTANCE	DESCRIPTION
1.	75.87'	Due N to NE 24-17-4 (rebar)
2.	149.57'	SE corner of ADDRESS 8642 12"up
3.	69.05'	Large road nail SE PwP#8-22A 10"up
4.	65.68'	Top nut of fire hydrant
5.	22.27'	PK nail W PwP#7-221 A 12"up
6.	35.32'	Top steel corner post
7.	117.34'	Nail S PwP#7-221 A
8.	158.84'	SW corner of ADDRESS 8642